



3, 6, 10, 16, 20, 26 & 32 Contacts  
+2 Control Contacts & Ground

Install to Matching Series Hood/Base



|                       |                       |                       |                       |                       |
|-----------------------|-----------------------|-----------------------|-----------------------|-----------------------|
| 10 + G<br>+ 2 Control | 16 + G<br>+ 2 Control | 20 + G<br>+ 2 Control | 26 + G<br>+ 2 Control | 32 + G<br>+ 2 Control |
|-----------------------|-----------------------|-----------------------|-----------------------|-----------------------|



### Screw Terminal Inserts

| SCREW TERMINAL INSERTS  | 10 + G<br>+2 CONTROL | 16 + G<br>+2 CONTROL | 20 + G<br>+2 CONTROL | 26 + G<br>+2 CONTROL | 32 + G<br>+2 CONTROL |
|---|----------------------|----------------------|----------------------|----------------------|----------------------|
|  <b>MALE – PINS</b><br>20–14 AWG (0.5–2.5 mm <sup>2</sup> )      | MS210V               | MS216V               | MS210V               | MS210V+<br>MS216V    | 2x MS216V            |
|  <b>FEMALE – SLEEVES</b><br>20–14 AWG (0.5–2.5 mm <sup>2</sup> ) | FS110V               | FS116V               | FS110V               | FS110V+<br>FS116V    | 2x FS116V            |

### Crimp Terminal Inserts

| CRIMP TERMINAL INSERTS   | 10 + G<br>+2 CONTROL | 16 + G<br>+2 CONTROL | 20 + G<br>+2 CONTROL | 26 + G<br>+2 CONTROL | 32 + G<br>+2 CONTROL |
|--|----------------------|----------------------|----------------------|----------------------|----------------------|
|  <b>MALE INSERT</b><br>(Order contacts below)    | MC410V               | MC416V               | MC410V x2            | MC410V+<br>MC416V    | 2x MC416V            |
|  <b>FEMALE INSERT</b><br>(Order contacts below) | FC310V               | FC316V               | FC310V x2            | FC310V+<br>FC316V    | 2x FC316V            |



Use small blade screwdriver to push wire entry tab in for easy contact removal.

### Crimp Tool





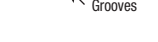
CAT. NO.

WT611TB



### Contacts Selection

For all "V" Inserts

| CRIMP CONTACTS  | WIRE AWG (MM <sup>2</sup> )      | IDENTIFICATION | FEMALE | MALE   | SWITCH/CONTROL |
|---|----------------------------------|----------------|--------|--------|----------------|
|  | 20 AWG (0.5 mm <sup>2</sup> )    | No Groove      | FP2000 | MP2000 | —              |
|  | 18 AWG (0.75–1 mm <sup>2</sup> ) | 1 Groove       | FP1800 | MP1800 | CP1800         |
|  | 16 AWG (1.5 mm <sup>2</sup> )    | 2 Grooves      | FP1600 | MP1600 | CP1800         |
|  | 14 AWG (2.5 mm <sup>2</sup> )    | 3 Grooves      | FP1400 | MP1400 | CP1400         |
|  | 12 AWG (4.0 mm <sup>2</sup> )    | No Groove      | FP1200 | MP1200 | —              |

Grooves